

Von: SCGBOX Customer_Sales_Mail <CSMail.box@setra.com>
Gesendet: Freitag, 22. Januar 2021 21:17
An: Hannes Probst
Betreff: RE: SR 34814 M239

Hello Hannes,

Thank you for the request.

Please see each comment for each serial number from the repair tech.

7554970-1/8/2021: AF IN SPEC. MINOR CAL DONE.
4995087: AF, SENSOR COVER WAS MOVED BY THE CUSTOMER 90 DEG. AF DATA WAS OUT OF SPEC. MINOR RE-CAL DONE.
4995088-1/8/2021: AF OUT OF SPEC FOR ZERO. MINOR RECAL DONE.
4995086-1/8/2021: AS FOUND OUT OF SPEC. MAJOR RECAL DONE.
4995083-1/8/2021: AF OUT OF SPEC. MINOR RECAL DONE.
4995089-1/8/2021: AS FOUND OUT OF SPEC. CANNOT ADJUST NON-LIN TO MEET SPEC. NOT COST EFFECTIVE TO REPAIR.
4995081-1/8/2021: AF OUT OF SPEC FOR SPAN. UNIT OUTPUT INTERMITTENTLY JUMPS UP TO 15VDC. NOT COST EFFECTIVE TO REPAIR.
4995082-1/8/2021: AF OUT OF SPEC FOR ZERO AT 5.8%. ZERO SHIFTED DOWN 5% AFTER FULL SCALE PRESSURE WAS RELEASED. NOT COST EFFECTIVE TO REPAIR

Please let me know if you have any questions or if I can be of further assistance.

Regards,
Jared Kent
Customer Service Representative
Setra Systems, Inc.
159 Swanson Road | Boxborough, MA 01719 | USA
Phone: +1.978.263.1400
jared.kent@setra.com